




## Operation Instructions

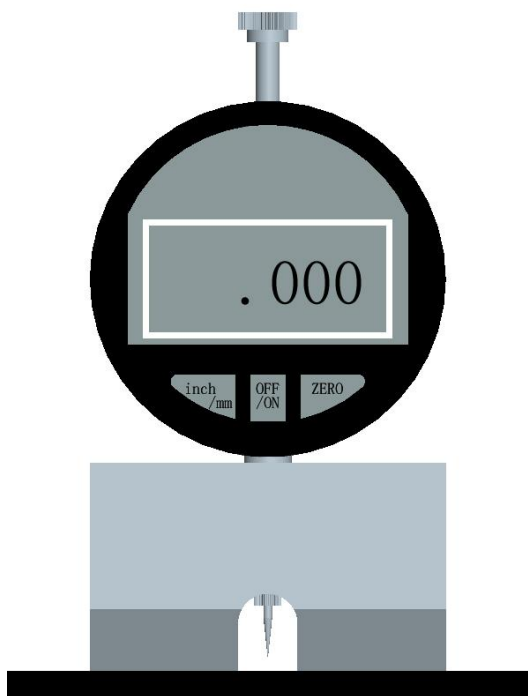

1. Attach the indicator into the hole in the base and lock it with the wrench.

2. Place the base on a flat smooth surface (preferably a surface plate) and move the measuring tip down until it touches the flat surface.

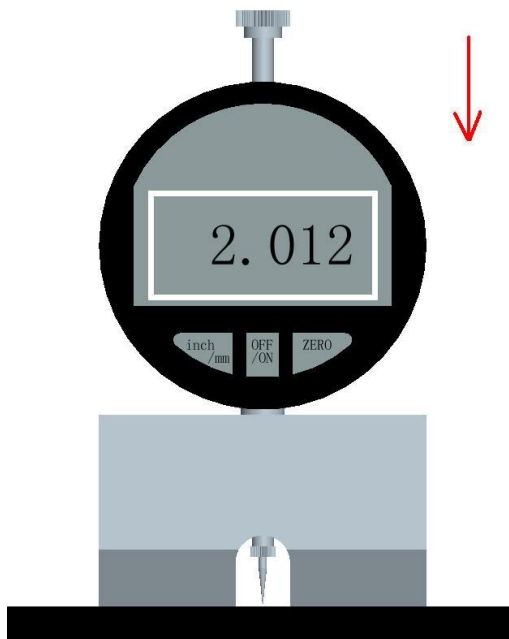

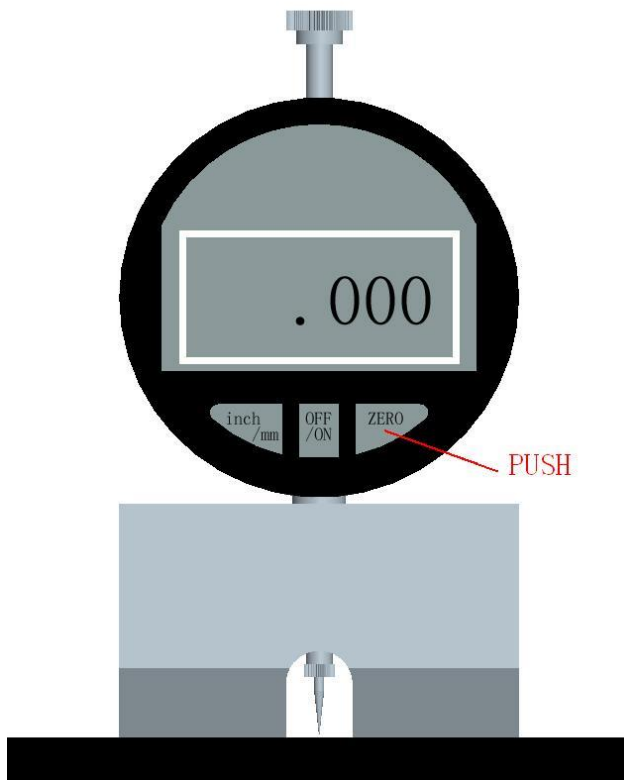

3. While holding the measuring tip against the surface from Step 2 press ZERO button to set the 000 position.

4. Before testing confirm the ZERO is set. If not please repeat steps 1-4.