# PosiTector DPM Dew Point Meter



Measures and records climatic conditions including: Relative humidity, air temperature, surface temperature, dew point temperature, and difference between surface and dew point temperatures. Ideal for surface preparation as required by ISO 8502-4.



Select from 5 probe models



Available on the App Store



A

PosiTector® SmartLink Compatible

S



# MEASURES

RH – relative humidity

Ta – air temperature

Ts – surface temperature

v - wind velocity

#### CALCULATES

E.

T<sub>d</sub> – dew point temperature
T<sub>S</sub>–T<sub>d</sub> – the difference between
surface and dew point temperatures
T<sub>w</sub> – wet bulb



www.BergEng.com
Berg Engineering & Sales Company, Inc.

## PosiTector DPM Dew Point Meter

# All Gages Feature...

#### Simple

- All readings are constantly updated and displayed simultaneously
- Alarms indicate when climate conditions are unsuitable for painting
- NEW Larger 2.8" impact resistant color touchscreen with redesigned keypad for quick menu navigation

#### **Durable**

- NEW Weatherproof, dustproof, and water-resistant—IP65-rated enclosure
- Shock-absorbing protective rubber holster for added impact resistance
- Two year warranty on gage body AND probe

#### **Accurate**

- Fast response precision sensors provide accurate, repeatable readings
- Smart Trend<sup>™</sup> indicators identify rising, falling, or stable readings
- Certificate of Calibration showing traceability to NIST included
- Conforms to national and international standards including ISO and ASTM

#### Versatile

- PosiTector body accepts all PosiTector DPM, IRT, 6000, 200, RTR, SPG, SST, SHD, BHI, and UTG probes easily converting from a dew point meter to a coating thickness gage, surface profile gage, soluble salt tester, hardness tester, or ultrasonic wall thickness gage
- Auto Log mode records environmental parameters at user selected time intervals
- NEW Auto rotating display with Flip Lock

#### **Powerful**

- **NEW** Screen Capture—save 100 screen images for record keeping and review
- NEW Instant-on feature quickly powers up the gage if recently powered down
- **NEW** Up to 30% longer battery life
- USB port for fast, simple connection to a PC and to supply continuous power. USB cable included.
- PosiSoft USB Drive—stored readings and graphs can be accessed using universal PC/Mac web browsers or file explorers. No software required.
- Every stored measurement is date and time stamped
- Includes PosiSoft suite of software for viewing and reporting data

#### Standard Models

#### Includes ALL features as shown on left plus...

- Storage of 2,500 datasets per probe—stored readings can be viewed or downloaded
- Auto Log mode runs unattended on batteries for up to 50 hours or continuously via USB

#### **Advanced Models**

#### Includes ALL features as shown on left plus...

- NEW Storage of 250,000 datasets from multiple probes in up to 1,000 batches
- Enhanced Auto Log mode powers the gage off between readings for up to 8 months of battery life. Each reading can be uploaded to PosiSoft.net or an FTP server using WiFi. Automatically group readings into batches at daily, weekly, or monthly intervals
- User defined alarms for all parameters—visible and audible warnings. Receive email alerts when connected to WiFi
- Trend Charts graph readings in real-time
- NEW Touchscreen keyboard for quickly renaming batches, adding notes, and more
- WiFi technology wirelessly synchronizes with PosiSoft.net and downloads software updates
- Bluetooth 4.0 Technology for data transfer to a mobile device running the PosiTector App or optional portable printer. BLE API available for integration into third-party software.
- Store thickness, profile, environmental, salt contamination, hardness, and wall thickness measurements in individual batches
- Wet bulb temperature can be displayed and recorded

#### **PosiTector SmartLink™ Compatible**

- Wirelessly connect PosiTector DPM and DPMS probes to your smart device
- Turns your cell phone or tablet into a virtual PosiTector gage
- Includes Free mobile app


For a complete comparison visit www.defelsko.com/dpm



# Remote Monitoring with Auto Log Mode

In addition to its capability as a handheld instrument, the PosiTector DPM Advanced model's innovative Auto Log feature can be used to. . .

- Monitor and record climatic conditions at user-selected intervals.
   Advanced models allow you to create new batches at daily, weekly, or monthly intervals.
- Upload readings to the cloud-based PosiSoft.net website after each measurement\*
- Receive email alerts when readings exceed pre-defined parameters\*
- Upload readings to an FTP server for integration with third party software\*
- View environmental readings from one or more gages in remote locations from PosiSoft Desktop software or web-based PosiSoft.net
- \* requires an internet connection

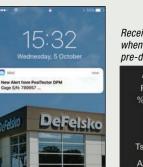

Receive email alerts when readings exceed pre-defined parameters



email Setup
Enabled 
When enabled, alarm alerts will be sent to the email address below.
email address:
alarm@defelsko.com

Test email


OK

Cancel

Access your data from any webconnected device.



PosiSoft Desktop software includes the PosiTector DPM Monitor feature for continuous charting of readings from one or more dew point meters. PosiTector DPM Monitor refreshes data from PosiSoft.net once every minute.

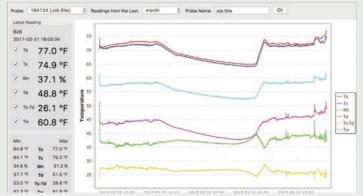



	Poulloctor    12	Posificator  SN 73.71 13 76.9 13 77.4 14 66.79 13-14 9.51	Posificator  Valve 73.51 19.26.59 19.29.91 19.21.4 19.19.8.51	Position to / 25.1 V 0.1 m     (a) (a) (b) (c) (c) (c) (c) (c) (c) (c) (c) (c) (c	Peallector  100 46.41  10 22.41  10 10.41
Probe Description	Integral Probe with Direct Contact Surface Temperature Sensor	Integral Probe with Infrared Surface Temperature Sensor	Integral Probe with K-type Cabled Surface Temperature Sensor	Integral Probe with Wind Speed Sensor	Cabled Probe with 1/2" NPT Threads
Measured/ Calculated Parameters	Surface Temperature Air Temperature Wet Bulb Temperature* Relative Humidity Dew Point Temperature Surface Temperature minus Dew Point Temperature	Surface Temperature Air Temperature Wet Bulb Temperature* Relative Humidity Dew Point Temperature Surface Temperature minus Dew Point Temperature	Surface Temperature Air Temperature Wet Bulb Temperature* Relative Humidity Dew Point Temperature Surface Temperature minus Dew Point Temperature	Surface Temperature Air Temperature Wet Bulb Temperature* Relative Humidity Dew Point Temperature Surface Temperature minus Dew Point Temperature	Air Temperature  Relative Humidity  Dew Point Temperature
Ordering Gui	de			Wind Speed	
Standard Body and Probe	DPM1	DPMIR1	DPMS1	DPMA1	DPMD1
Advanced Body and Probe	DPM3	DPMIR3	DPMS3	DPMA3	DPMD3
Probe only	PRBDPM	PRBDPMIR	PRBDPMS	PRBDPMA	PRBDPMD

<sup>\*</sup>Wet Bulb Temperature displayed/recorded on PosiTector Advanced (3) models only

ALL GAGES COME COMPLETE with environmental sensors, protective rubber holster, wrist strap, 3 AAA batteries, instructions, nylon carrying case with shoulder strap (DPM/DPMIR/DPMA/DPMD), hard shell carrying case (DPMS), protective lens shield, Long Form Certificate of Calibration traceable to NIST, USB cable, two year warranty.

\*SIZE: 127 x 66 x 25.4 mm \*WEIGHT: 137 g (4.9 oz.) without batteries (5" x 2.6" x 1")

Conforms to ISO 8502-4, BS 7079-B4, ASTM D3276, IMO PSPC, SSPC-PA7 and US Navy NSI 009-32.



Hot-wire anemometer with your choice of wind speed measurement units - m/s, km/h, mph, ft/s, ft/m, knots. DPM A models only.











Analyze Readings using a web browser



<sup>\*</sup> Size and weight are for the PosiTector gage body only and do not include the probe.

## Rugged Features...





Specifications	Range	Accuracy	Resolution	
	-40° to 80° C	± 0.5° C	0.1° C	
Surface	80° to 190° C	± 1.5° C	0.1 6	
Temperature	–40° to 175° F	± 1° F 0.1° F		
	175° to 375° F	± 3° F	0.1 F	
Infrared Surface	-70° to 380° C	± 1°C + 1%²	0.1° C	
Temperature <sup>1</sup>	–94° to 716° F	± 2°F + 1%²	0.1° F	
Air	-40° to 80° C	± 0.5° C	0.1° C	
Temperature	-40° to 175° F	± 1° F	0.1° F	
Humidity	0 to 100%	± 3%	0.1%	
Wind Cnood <sup>3</sup>	0 to 20 m/s	± 3% Full Scale	0.1 m/s	
Wind Speed <sup>3</sup>	0 to 44 mph	+ least significant digit	0.1 mph	
Dew Point	-60° to 80° C	± 3° C4	0.1° C	
Dew Pollit	-76° to 175° F	± 5.4° F <sup>‡</sup>	0.1° F	

- 1. DPM IR models only
- 2. At 23° C (73° F) ambient
- 3. DPM A models only
- 4. dependent on RH. See www.defelsko.com/TdAccuracy for more information.


PosiTector DPM IR Specifications				
Distance to Spot Ratio (D:S)	4:1			
Emissivity	Adjustable			
Response Time	<500 ms (95% response)			

### **Options**

#### **PosiTector Probes**

PosiTector body accepts all PosiTector DPM, IRT, 6000, 200, RTR, SPG, SST, SHD, BHI, and UTG probes easily converting from a dew point meter to a coating thickness gage, surface profile gage, soluble salt tester, hardness tester, or ultrasonic wall thickness gage.





# Additional K-type Sensors for use with the PosiTector DPMS only

#### **Hand-held Surface Temperature Probe**

for spot checking hard-to-reach surfaces

#### **Liquid Temperature Probe**

• general purpose probe with stainless steel shaft

© DeFelsko Corporation USA 2021. All Rights Reserved. Technical Data subject to change without notice. • Printed in USA • PDPM.v.LW/W2101



